

MONUMENT RECORD
State of Indiana - County of Monroe

Section: 14

Township: 9 North


Range: 1 East

Corner ID: BenSo S-11

Monument Description & Remarks: Sandstone with "X", length 1.60ft, width 0.80ft, height 0.80ft, (Sandstone in bedrock). Survey Sign 2.5ft above ground at pt. B

References On File: Darrell Breedlove, Forest Recovery Tie (1989); Michael Friley, M.C.S. Monument Record (1995); and Douglas Curry survey, Martin Subdivision (2008), on file in Surveyor Office

RECOVERY TIE DRAWING
Field Book 41 Page No. 58

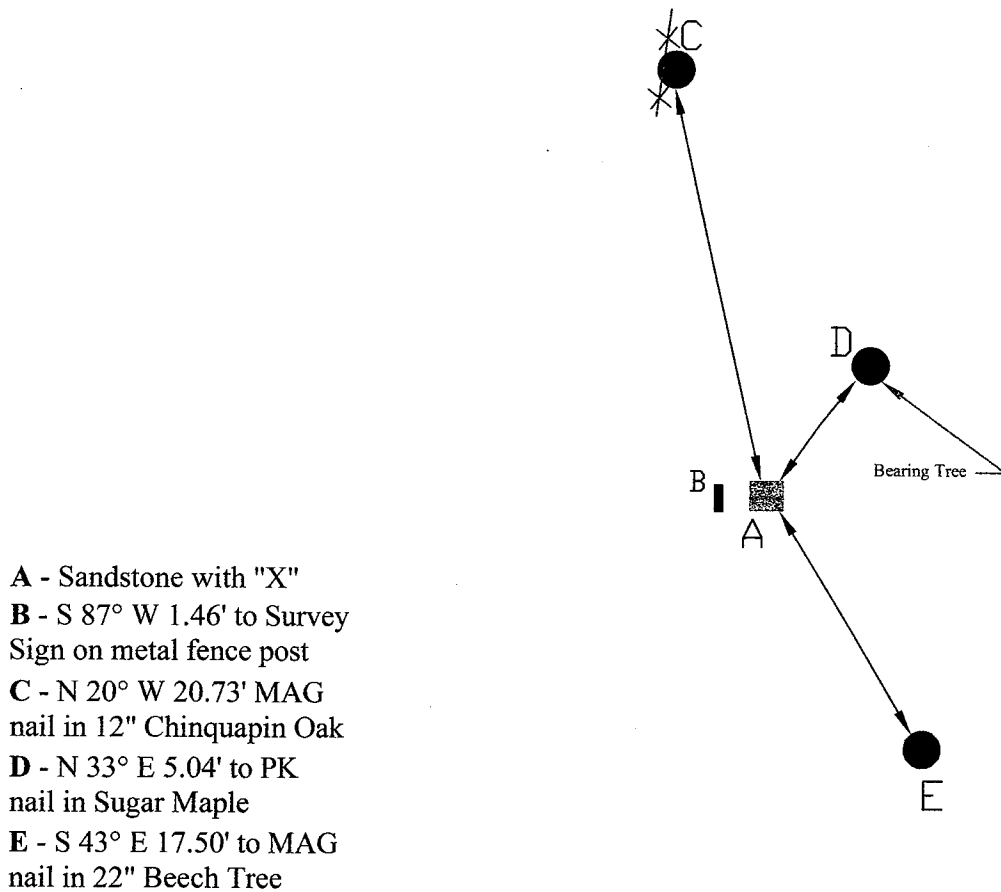


Not To Scale
Compass Bearing Magnetic North

I, Kevin P. Enright, Monroe County Surveyor, hereby certify that this document was prepared under my direction in accordance with the provisions of section 36-2-12-11 of the Indiana Code; and the above data is given under my hand and seal this 30th day of September, 2008.

Administered by the Monroe County Surveyor Review Board

Date: 1-13-2009

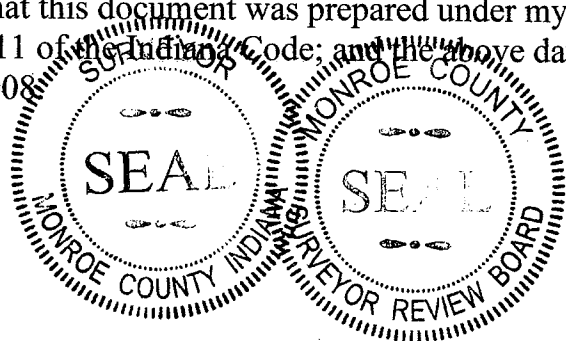

MONUMENT RECORD

Corner I.D. #

S-35



STATE OF INDIANA - COUNTY OF MONROE

S-11

Section Fourteen (14), Township 9 North, Range 1 East

Monument Description & Remarks: Stone w/"X" found at center of section.
Stone is flush w/ground and on-line between stones to east & west. Steel
fence post driven next to stone. Corner witnessed 11/16/89 . . . see attached

Recovery Tie Drawing

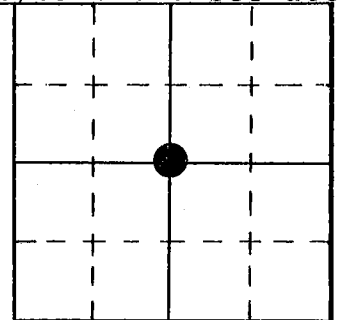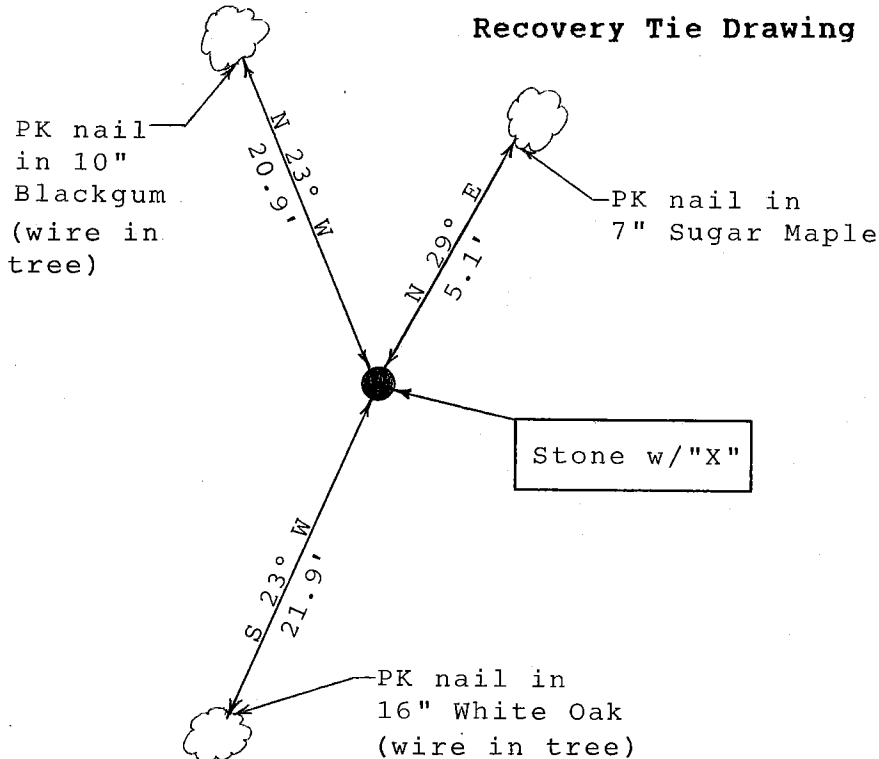

● At Corner



Not To Scale

State of Indiana
County of Monroe

I, Michael W. Friley, County Surveyor, hereby certify
that this document was prepared under my direction in
accordance with the provisions of Section 17-3-64-4
through 17-3-64-8 of the Indiana Code, being Acts of 1965,
Chapter 319; and the above data is given under my hand and
seal this 6th day of February, 1995 A.D.

Space
Reserved For
Recording
Officer

Indiana Registered Land Surveyor No. _____ or

Morgan-Monroe State Forest

United States Government Agency

Darrell Breedlove, Timber Specialist

Title

Field Book:

n/a

Page:

n/a

SECTION 14, T9N, R1E

In June 28, 1989 the center of the NE $\frac{1}{4}$, Sec. 14 was witnessed as follows: PK
nails were driven at the base of these trees.

<u>AZ</u>	<u>Sp.</u>	<u>DBH(in)</u>	<u>Distance(ft)</u>
076 ^o	Black Oak	16	19.7
156	Red Maple	8	20.2
258	Flowering Dogwood	3	12.8

This stone has an "x" and measures "x" "x". It is NO. 2°W (1°W) from the SE corner, SW $\frac{1}{4}$, NE $\frac{1}{4}$, Sec. 14 (see 3h).

1) On June 30, 1989, the West line of the E $\frac{1}{2}$, NW $\frac{1}{4}$, Sec.14 was painted and posted with plastic signs, and yellow metal tags were placed near stones.

Daniel Breedlove

D. Breedlove

4a) On Nov.16, 1989, the center stone of Sec.14 was located on-line between stones east and west of it (see 3b and 3h). This stone has an "x", and it is flush with the ground. It is witnessed with PK nails as follows:

<u>Az</u>	<u>Species</u>	<u>DBH(in.)</u>	<u>Distance(ft.)</u>	<u>Comment</u>
029 ^o	Sugar Maple	7	5.1 N 29° E	✓
337	Blackgum	10	20.9 N 23° W	✓
203	White Oak	16	21.9 S 23° W	✓ has wire in it has wire in it

A steel fence post was driven next to the stone.

b) On Nov.20, 1989, a rebar was located at the east $\frac{1}{4}$ - $\frac{1}{4}$ corner of the NE $\frac{1}{4}$, Sec.14. It is N 88.6° E (1°W) of the stone at the center of the NE $\frac{1}{4}$, Sec.14 (see 3k).

c) On Nov.20, 1989, the following lines were painted and posted in Sec.14: south line of SE $\frac{1}{4}$, NW $\frac{1}{4}$; south & east lines of SW $\frac{1}{4}$, NE $\frac{1}{4}$; and south line of NE $\frac{1}{4}$, NE $\frac{1}{4}$.

d) On Dec.20, 1989, the north line of NE $\frac{1}{4}$, SE $\frac{1}{4}$, Sec.14 was painted and posted. A rebar at the east $\frac{1}{2}$ -mile of Sec.14 was not used, since it does not line up with three stones found along the east-west center-line of Sec.14 (see 3b, h, & j and 4a). Instead, the old fence corner was used.

e) On Dec.12, 1989, a steel fence post was driven next to the south $\frac{1}{4}$ - $\frac{1}{4}$ corner of the NW $\frac{1}{4}$, Sec.14 (see 3b).

f.) On Jan. 26, 1990, a stone at the center $\frac{1}{4}$ - $\frac{1}{4}$ corner (SW corner, NE $\frac{1}{4}$, SE $\frac{1}{4}$) of the SE $\frac{1}{4}$, Sec.14 was witnessed as follows:

<u>Az</u>	<u>Species</u>	<u>DBH(in.)</u>	<u>Distance(ft.)</u>	<u>Comment</u>
161 ^o	Sugar Maple	11	22.8	n. side of stream
307	Sugar Maple	12	16.7	n. side of stream
216	Am. Beech	9	35.4	s. side of stream

This stone has "R" and "RIENSCH" inscribed on its top, which are the last initial and last name of the adjoining landowner, who set the stone following a survey. A 1" steel pipe sits next to the stone, and both markers are flush with the ground. This stone is N 89.8° E (1°W)



Small white tag with red text and a red ribbon.

Yellow tag with black text.

073 14024

Ben So S-11
09/30/2008